

MAPEI ULTRACOLOR PLUS

Chemwatch Independent Material Safety Data Sheet

Issue Date: 10-Jul-2008

NC317TCP

CHEMWATCH 5142-04

Version No:4

CD 2010/1 Page 1 of 10

Section 1 - CHEMICAL PRODUCT AND COMPANY IDENTIFICATION

PRODUCT NAME

MAPEI ULTRACOLOR PLUS

PRODUCT USE

Ready-mixed cement mortar for ceramic tile joints.

(VOC per CA South Coast Air Quality Management District, Rule 1168)

SUPPLIER

Company: Mapei Pty Ltd

Address:

12 Parkview Drive

Archerfield

QLD, 4108

AUS

Telephone: +61 7 3276 5000

Fax: +61 7 3276 5076


Email: mapei@mapei.com.au

Section 2 - HAZARDS IDENTIFICATION

STATEMENT OF HAZARDOUS NATURE

NON-HAZARDOUS SUBSTANCE. NON-DANGEROUS GOODS. According to NOHSC Criteria, and ADG Code.

CHEMWATCH HAZARD RATINGS

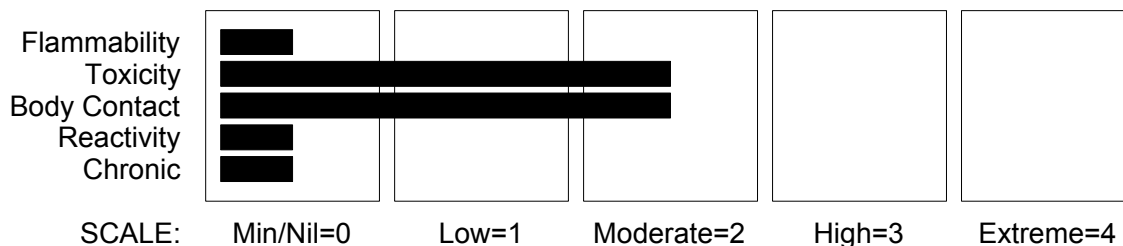

POISONS SCHEDULE

None

RISK

■ Ingestion may produce health damage*.

■ May produce discomfort of the eyes and skin*.

* (limited evidence).

SAFETY

■ Do not breathe dust.

■ Avoid contact with skin.

■ Wear eye/ face protection.

■ In case of contact with eyes rinse with plenty of water and contact Doctor or Poisons Information Centre.

continued...

MAPEI ULTRACOLOR PLUS

Chemwatch Independent Material Safety Data Sheet
Issue Date: 10-Jul-2008
NC317TCP

CHEMWATCH 5142-04
Version No:4
CD 2010/1 Page 2 of 10

Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

NAME	CAS RN	%
portland cement	65997-15-1	NotSpec
other ingredients determined not to be hazardous		

Section 4 - FIRST AID MEASURES

SWALLOWED

- If swallowed do NOT induce vomiting.
- If vomiting occurs, lean patient forward or place on left side (head-down position, if possible) to maintain open airway and prevent aspiration.
- Observe the patient carefully.
- Never give liquid to a person showing signs of being sleepy or with reduced awareness; i.e. becoming unconscious.
- Give water to rinse out mouth, then provide liquid slowly and as much as casualty can comfortably drink.
- Seek medical advice.

EYE

- If this product comes in contact with the eyes:
- Wash out immediately with fresh running water.
- Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.
- Seek medical attention without delay; if pain persists or recurs seek medical attention.
- Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

SKIN

- If skin contact occurs:
- Immediately remove all contaminated clothing, including footwear.
- Flush skin and hair with running water (and soap if available).
- Seek medical attention in event of irritation.

INHALED

- If fumes or combustion products are inhaled remove from contaminated area.
 - Other measures are usually unnecessary.
-

Section 5 - FIRE FIGHTING MEASURES

EXTINGUISHING MEDIA

- There is no restriction on the type of extinguisher which may be used.
- Use extinguishing media suitable for surrounding area.

FIRE FIGHTING

- Alert Fire Brigade and tell them location and nature of hazard.
- Wear breathing apparatus plus protective gloves for fire only.
- Prevent, by any means available, spillage from entering drains or water courses.
- Use fire fighting procedures suitable for surrounding area.
- DO NOT approach containers suspected to be hot.
- Cool fire exposed containers with water spray from a protected location.
- If safe to do so, remove containers from path of fire.
- Equipment should be thoroughly decontaminated after use.

continued...

MAPEI ULTRACOLOR PLUS

Chemwatch Independent Material Safety Data Sheet

Issue Date: 10-Jul-2008

NC317TCP

CHEMWATCH 5142-04

Version No:4

CD 2010/1 Page 3 of 10

Section 5 - FIRE FIGHTING MEASURES

FIRE/EXPLOSION HAZARD

- Non combustible.
 - Not considered a significant fire risk, however containers may burn.
- May emit poisonous fumes.
May emit corrosive fumes.

FIRE INCOMPATIBILITY

- None known.

HAZCHEM

None

PERSONAL PROTECTION

Glasses:
Chemical goggles.

Gloves:
PVC chemical resistant type.

Respirator:
Particulate

Section 6 - ACCIDENTAL RELEASE MEASURES

MINOR SPILLS

- Remove all ignition sources.
- Clean up all spills immediately.
- Avoid contact with skin and eyes.
- Control personal contact by using protective equipment.
- Use dry clean up procedures and avoid generating dust.
- Place in a suitable, labelled container for waste disposal.

MAJOR SPILLS

- Moderate hazard.
- CAUTION: Advise personnel in area.
- Alert Emergency Services and tell them location and nature of hazard.
- Control personal contact by wearing protective clothing.
- Prevent, by any means available, spillage from entering drains or water courses.
- Recover product wherever possible.
- IF DRY: Use dry clean up procedures and avoid generating dust. Collect residues and place in sealed plastic bags or other containers for disposal. IF WET: Vacuum/shovel up and place in labelled containers for disposal.
- ALWAYS: Wash area down with large amounts of water and prevent runoff into drains.
- If contamination of drains or waterways occurs, advise Emergency Services.

Personal Protective Equipment advice is contained in Section 8 of the MSDS.

Section 7 - HANDLING AND STORAGE

PROCEDURE FOR HANDLING

- Avoid all personal contact, including inhalation.
- Wear protective clothing when risk of exposure occurs.
- Use in a well-ventilated area.
- Prevent concentration in hollows and sumps.
- DO NOT enter confined spaces until atmosphere has been checked.

continued...

MAPEI ULTRACOLOR PLUS

Chemwatch Independent Material Safety Data Sheet

Issue Date: 10-Jul-2008

NC317TCP

CHEMWATCH 5142-04

Version No:4

CD 2010/1 Page 4 of 10

Section 7 - HANDLING AND STORAGE

- DO NOT allow material to contact humans, exposed food or food utensils.
- Avoid contact with incompatible materials.
- When handling, DO NOT eat, drink or smoke.
- Keep containers securely sealed when not in use.
- Avoid physical damage to containers.
- Always wash hands with soap and water after handling.
- Work clothes should be laundered separately. Launder contaminated clothing before re-use.
- Use good occupational work practice.
- Observe manufacturer's storing and handling recommendations.
- Atmosphere should be regularly checked against established exposure standards to ensure safe working conditions are maintained.

SUITABLE CONTAINER

- Polyethylene or polypropylene container.
- Check all containers are clearly labelled and free from leaks.

STORAGE INCOMPATIBILITY

- None known.

STORAGE REQUIREMENTS

- Store in original containers.
- Keep containers securely sealed.
- Store in a cool, dry area protected from environmental extremes.
- Store away from incompatible materials and foodstuff containers.
- Protect containers against physical damage and check regularly for leaks.
- Observe manufacturer's storing and handling recommendations

For major quantities:

- Consider storage in bunded areas - ensure storage areas are isolated from sources of community water (including stormwater, ground water, lakes and streams).
- Ensure that accidental discharge to air or water is the subject of a contingency disaster management plan; this may require consultation with local authorities.

SAFE STORAGE WITH OTHER CLASSIFIED CHEMICALS



+: *May be stored together*

O: *May be stored together with specific preventions*

X: *Must not be stored together*

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

EXPOSURE CONTROLS

Source	Material	TWA mg/m ³	Notes
Australia Exposure Standards	portland cement (Portland cement (a))	10	(see Chapter 14)

continued...

MAPEI ULTRACOLOR PLUS

Chemwatch Independent Material Safety Data Sheet

Issue Date: 10-Jul-2008

NC317TCP

CHEMWATCH 5142-04

Version No:4

CD 2010/1 Page 5 of 10

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

EMERGENCY EXPOSURE LIMITS

Material	Revised IDLH Value (mg/m3)	Revised IDLH Value (ppm)
portland cement	5,000	

MATERIAL DATA

MAPEI ULTRACOLOR PLUS:

Not available

PORTLAND CEMENT:

- for calcium silicate:

containing no asbestos and <1% crystalline silica

ES TWA: 10 mg/m3 inspirable dust

TLV TWA: 10 mg/m3 total dust (synthetic nonfibrous) A4

Although in vitro studies indicate that calcium silicate is more toxic than substances described as "nuisance dusts" is thought that adverse health effects which might occur following exposure to 10-20 mg/m3 are likely to be minimal. The TLV-TWA is thought to be protective against the physical risk of eye and upper respiratory tract irritation in workers and to prevent interference with vision and deposition of particulate in the eyes, ears, nose and mouth.

For calcium oxide:




The TLV-TWA is thought to be protective against undue irritation and is analogous to that recommended for sodium hydroxide.

The concentration of dust, for application of respirable dust limits, is to be determined from the fraction that penetrates a separator whose size collection efficiency is described by a cumulative log-normal function with a median aerodynamic diameter of 4.0 μm (+-) 0.3 μm and with a geometric standard deviation of 1.5 μm (+-) 0.1 μm , i.e..generally less than 5 μm .

NOTE: This substance has been classified by the ACGIH as A4 NOT classifiable as causing Cancer in humans.

Portland cement is considered to be a nuisance dust that does not cause fibrosis and has little potential to induce adverse effects on the lung.

PERSONAL PROTECTION

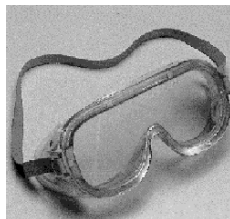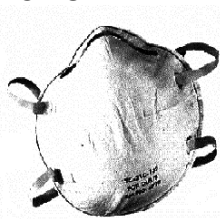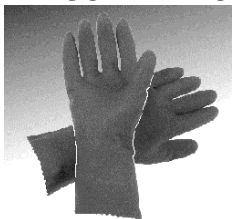

EYE

- Safety glasses with side shields.
- Chemical goggles.
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lens or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59].

continued...

MAPEI ULTRACOLOR PLUS

Chemwatch Independent Material Safety Data Sheet

Issue Date: 10-Jul-2008

NC317TCP

CHEMWATCH 5142-04

Version No:4

CD 2010/1 Page 6 of 10

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

HANDS/FEET

■ Suitability and durability of glove type is dependent on usage. Important factors in the selection of gloves include: such as:

- frequency and duration of contact,
- chemical resistance of glove material,
- glove thickness and
- dexterity

Select gloves tested to a relevant standard (e.g. Europe EN 374, US F739).

- When prolonged or frequently repeated contact may occur, a glove with a protection class of 5 or higher (breakthrough time greater than 240 minutes according to EN 374) is recommended.
- When only brief contact is expected, a glove with a protection class of 3 or higher (breakthrough time greater than 60 minutes according to EN 374) is recommended.
- Contaminated gloves should be replaced.

Gloves must only be worn on clean hands. After using gloves, hands should be washed and dried thoroughly.

Application of a non-perfumed moisturiser is recommended.

Experience indicates that the following polymers are suitable as glove materials for protection against undissolved, dry solids, where abrasive particles are not present.

- polychloroprene
- nitrile rubber
- butyl rubber
- fluorocautchouc
- polyvinyl chloride

Gloves should be examined for wear and/ or degradation constantly.

- Wear chemical protective gloves, eg. PVC.
- Wear safety footwear or safety gumboots, eg. Rubber.

OTHER

- Overalls.
- P.V.C. apron.
- Barrier cream.
- Skin cleansing cream.
- Eye wash unit.

RESPIRATOR

Protection Factor	Half- Face Respirator	Full- Face Respirator	Powered Air Respirator
10 x ES	P1 Air- line*	--	PAPR- P1 -
50 x ES	Air- line**	P2	PAPR- P2
100 x ES	-	P3	-
		Air- line*	-
100+ x ES	-	Air- line**	PAPR- P3

* - Negative pressure demand

** - Continuous flow.

The local concentration of material, quantity and conditions of use determine the type of personal protective equipment required. For further information consult site specific CHEMWATCH data (if available), or your Occupational Health and Safety Advisor.

ENGINEERING CONTROLS

- Local exhaust ventilation is required where solids are handled as powders or crystals; even when particulates are relatively large, a certain proportion will be powdered by mutual friction.
- If in spite of local exhaust an adverse concentration of the substance in air could occur, respiratory protection should be considered.

Such protection might consist of:

- (a): particle dust respirators, if necessary, combined with an absorption cartridge;
- (b): filter respirators with absorption cartridge or canister of the right type;

continued...

MAPEI ULTRACOLOR PLUS

Chemwatch Independent Material Safety Data Sheet

Issue Date: 10-Jul-2008

NC317TCP

CHEMWATCH 5142-04

Version No:4

CD 2010/1 Page 7 of 10

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

(c): fresh-air hoods or masks.

Air contaminants generated in the workplace possess varying "escape" velocities which, in turn, determine the "capture velocities" of fresh circulating air required to effectively remove the contaminant.

Type of Contaminant:

direct spray, spray painting in shallow booths, drum filling, conveyer loading, crusher dusts, gas discharge (active generation into zone of rapid air motion)
grinding, abrasive blasting, tumbling, high speed wheel generated dusts (released at high initial velocity into zone of very high rapid air motion).

Air Speed:

1- 2.5 m/s (200- 500 f/min.)

2.5- 10 m/s (500- 2000 f/min.)

Within each range the appropriate value depends on:

Lower end of the range

- 1: Room air currents minimal or favourable to capture
- 2: Contaminants of low toxicity or of nuisance value only.
- 3: Intermittent, low production.
- 4: Large hood or large air mass in motion

Upper end of the range

- 1: Disturbing room air currents
- 2: Contaminants of high toxicity
- 3: High production, heavy use
- 4: Small hood- local control only

Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple extraction pipe. Velocity generally decreases with the square of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point should be adjusted, accordingly, after reference to distance from the contaminating source. The air velocity at the extraction fan, for example, should be a minimum of 4-10 m/s (800-2000 f/min) for extraction of crusher dusts generated 2 metres distant from the extraction point. Other mechanical considerations, producing performance deficits within the extraction apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more when extraction systems are installed or used.

Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

APPEARANCE

Coloured powder with a slight odour, typical of cement; partially miscible with water.

PHYSICAL PROPERTIES

State	Divided Solid	Molecular Weight	Not Available
Melting Range (°C)	Not Available	Viscosity	Not Available
Boiling Range (°C)	Not Available	Solubility in water (g/L)	Partly Miscible
Flash Point (°C)	Not Applicable	pH (1% solution)	11 (10% dispersion)
Decomposition Temp (°C)	Not Available	pH (as supplied)	Not Available

continued...

MAPEI ULTRACOLOR PLUS

Chemwatch Independent Material Safety Data Sheet

Issue Date: 10-Jul-2008

NC317TCP

CHEMWATCH 5142-04

Version No:4

CD 2010/1 Page 8 of 10

Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

Autoignition Temp (°C)	Not Available	Vapour Pressure (kPa)	Not Available
Upper Explosive Limit (%)	Not Available	Specific Gravity (water=1)	1.3
Lower Explosive Limit (%)	Not Available	Relative Vapour Density (air=1)	Not Available
Volatile Component (%vol)	<0.1 g/l (VOC)	Evaporation Rate	Not Available

Section 10 - CHEMICAL STABILITY AND REACTIVITY INFORMATION

CONDITIONS CONTRIBUTING TO INSTABILITY

- Presence of incompatible materials.
- Product is considered stable.
- Hazardous polymerisation will not occur.

For incompatible materials - refer to Section 7 - Handling and Storage.

Section 11 - TOXICOLOGICAL INFORMATION

POTENTIAL HEALTH EFFECTS

ACUTE HEALTH EFFECTS

SWALLOWED

- Accidental ingestion of the material may be damaging to the health of the individual.

EYE

- There is some evidence to suggest that this material can cause eye irritation and damage in some persons.

SKIN

- There is some evidence to suggest that this material can cause inflammation of the skin on contact in some persons.

Entry into the blood-stream, through, for example, cuts, abrasions or lesions, may produce systemic injury with harmful effects. Examine the skin prior to the use of the material and ensure that any external damage is suitably protected.

INHALED

- The material is not thought to produce either adverse health effects or irritation of the respiratory tract following inhalation (as classified by EC Directives using animal models). Nevertheless, adverse systemic effects have been produced following exposure of animals by at least one other route and good hygiene practice requires that exposure be kept to a minimum and that suitable control measures be used in an occupational setting.

CHRONIC HEALTH EFFECTS

- Long term exposure to high dust concentrations may cause changes in lung function i.e. pneumoconiosis; caused by particles less than 0.5 micron penetrating and remaining in the lung. Prime symptom is breathlessness; lung shadows show on X-ray.

TOXICITY AND IRRITATION

- Not available. Refer to individual constituents.

continued...

MAPEI ULTRACOLOR PLUS

Chemwatch Independent Material Safety Data Sheet

Issue Date: 10-Jul-2008

NC317TCP

CHEMWATCH 5142-04

Version No:4

CD 2010/1 Page 9 of 10

Section 12 - ECOLOGICAL INFORMATION

Refer to data for ingredients, which follows:

PORTLAND CEMENT:

MAPEI ULTRACOLOR PLUS:

- DO NOT discharge into sewer or waterways.

MAPEI ULTRACOLOR PLUS:

PORTLAND CEMENT:

■ Metal-containing inorganic substances generally have negligible vapour pressure and are not expected to partition to air. Once released to surface waters and moist soils their fate depends on solubility and dissociation in water. Environmental processes (such as oxidation and the presence of acids or bases) may transform insoluble metals to more soluble ionic forms. Microbiological processes may also transform insoluble metals to more soluble forms. Such ionic species may bind to dissolved ligands or sorb to solid particles in aquatic or aqueous media. A significant proportion of dissolved/ sorbed metals will end up in sediments through the settling of suspended particles. The remaining metal ions can then be taken up by aquatic organisms.

When released to dry soil most metals will exhibit limited mobility and remain in the upper layer; some will leach locally into ground water and/ or surface water ecosystems when soaked by rain or melt ice.

Environmental processes may also be important in changing solubilities.

Even though many metals show few toxic effects at physiological pHs, transformation may introduce new or magnified effects.

A metal ion is considered infinitely persistent because it cannot degrade further.

The current state of science does not allow for an unambiguous interpretation of various measures of bioaccumulation.

The counter-ion may also create health and environmental concerns once isolated from the metal. Under normal physiological conditions the counter-ion may be essentially insoluble and may not be bioavailable.

Environmental processes may enhance bioavailability.

Section 13 - DISPOSAL CONSIDERATIONS

- Recycle wherever possible or consult manufacturer for recycling options.
- Consult State Land Waste Management Authority for disposal.
- Bury residue in an authorised landfill.
- Recycle containers if possible, or dispose of in an authorised landfill.

Section 14 - TRANSPORTATION INFORMATION

HAZCHEM:

- None (ADG7)

NOT REGULATED FOR TRANSPORT OF DANGEROUS GOODS: ADG7, UN, IATA, IMDG

continued...

MAPEI ULTRACOLOR PLUS

Chemwatch Independent Material Safety Data Sheet

Issue Date: 10-Jul-2008

NC317TCP

CHEMWATCH 5142-04

Version No:4

CD 2010/1 Page 10 of 10

Section 15 - REGULATORY INFORMATION

POISONS SCHEDULE

None

REGULATIONS

Regulations for ingredients

portland cement (CAS: 65997-15-1) is found on the following regulatory lists;

"Australia Exposure Standards", "Australia High Volume Industrial Chemical List (HVICL)", "Australia Inventory of Chemical Substances (AICS)", "OECD Representative List of High Production Volume (HPV) Chemicals"

No data for Mapei Ultracolor Plus (CW: 5142-04)

Section 16 - OTHER INFORMATION

■ Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using available literature references.

A list of reference resources used to assist the committee may be found at:

www.chemwatch.net/references.

■ The (M)SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings. Risks may be determined by reference to Exposures Scenarios. Scale of use, frequency of use and current or available engineering controls must be considered.

This document is copyright. Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without written permission from CHEMWATCH. TEL (+61 3) 9572 4700.

Issue Date: 10-Jul-2008

Print Date: 23-Mar-2010

This is the end of the MSDS.